MSS. HS 30.41;

FATALITY INVESTIGATION REPORT

FACE Facts



Occupational Health Surveillance Roogram COLLECTION
Massachusetts Department of Public Health


January 1995 Vol. 1 No. 1

Temporary Worker Fatally Crushed

Paper Bales Topple at Recycling Plant

Background

The victim, an 18-year-old Hispanic male, and co-worker were hired as temporary laborers by a cleaning service and assigned to a paper recycling plant.

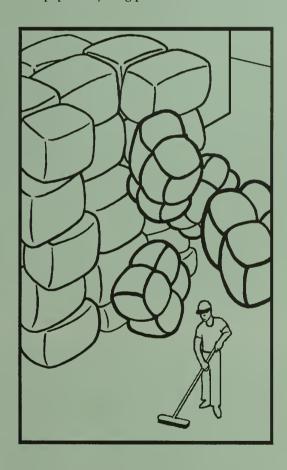

The company recycled and packaged paper. It had been in business for over four years. Waste paper was collected, separated, bound, and stacked in bales on site. The company had eight to ten regular employees, and routinely contracted the cleaning service to provide a crew of three or four laborers. The company did not employ a designated safety

Univergition or have written safety policies or procedures. Neither the company nor the cleaning service provided safety training for the temporary employees.

The Incident

The incident occurred 90 minutes into the victim's first day at the plant. He and two co-workers were alone in the main facility, sweeping in the vicinity of the plant waste-paper conveyor and stacked paper bales. The paper bales were stacked 25 feet deep and 18 feet (seven bales) high along the side of the building. Without warning, four of the bales of wire-bound waste paper fell 18 feet onto the victim and one of his co-workers. The bales weighed approximately 1,300 pounds and measured approximately four feet by two and a half feet by five feet each.

The victim suffered massive crushing injuries to the upper body and head and was pronounced dead at the scene. The co-worker was airlifted to a regional hospital where he survived the acute trauma.

Caused by Improper Stacking

The bale columns were top-heavy and stacked too high. In addition, they were not interlocked and one side of the columns was not adequately supported.

- Because the forklift could not fully reach the highest row, the top bale of each column overhung the next lower bale by a foot or more.
- Due in part to their irregular size and shape, many of the bales were not stacked in a square or firmly seated position on top of one another.

Recommendations

Employers must adhere to OSHA Standard 29 CFR 1910.176 (b), which requires bundles and other materials stored in tiers to be stacked, blocked, interlocked, and limited in height so that they are stable and secure against sliding or collapse.

Employers should further:

- ensure that forklift operators are properly trained in stacking and securing materials to prevent slippage or collapse;
- consider using stanchions with chains to brace stacked materials;
- ensure that contracted cleaning company personnel are fully informed of potential job-site safety hazards.

In addition, temporary agencies and contracting employers should specify in their contracts who is responsible for providing temporary employees with both general and job-specific health and safety training.

Fatality Assessment and Control Evaluation (FACE) Project

FATALITY INVESTIGATION REPORT

FACE Facts



Please Post

Occupational Health Surveillance Program Massachusetts Department of Public Health 150 Tremont Street, 8th Floor Boston MA 02111

he Massachusetts Department of Public Health, in cooperation with the Massachusetts Department of Labor and Industries and the National Institute for Occupational Safety and Health, conducts investigations of fatal work-related injuries. The project, known as FACE (Fatality Assessment and Control Evaluation), seeks to identify the factors that contribute to occupational fatalities. The FACE Project will help in the development and use of improved safety measures for preventing fatal injuries in the future.

We hope you find the "FACE Facts" informative and that you will share it with others. If you have any comments or questions, please call the FACE Project at (617) 727–2735.